PRODUCT 127

PRINTED IN U.S.A. I

P & P INDUSTRIAL COATINGS LLC
3251 N. Osage Drive
Tulsa, Oklahoma 74127
(918) 895-6030

Packing List

1584

CUSTOMER ORDER NO.	DATE SHIPPED	SHIPPED VIA	OUR NO.	SALESPERSON
F-0126-0601 PS	8/3/2020			

SHIP TO:	SOLD TO:
Testcorp	
Tulsa, OK	

√	QUANTITY	DESCRIPTION
	21	Misc. pipes, Valves
		P.O Connor

CARTONS	TOTAL WEIGHT	ORDER COMPLETE	BALANCE TO FOLLOW	PACKED BY	CHECKED BY

PLEASE NOTIFY US IMMEDIATELY
IF ERROR IS FOUND IN SHIPMENT

P&P Industrial Coatings

Tel: 918-895-6030 3251 N. Osage Dr. Tulsa, OK 74127 Fax: 918-895-6031

Paint Report #24

Date:	Company:	Item Name:	PO#:	Job#:
7/30/2026	TesCorp	Piping	F-0126-0001 P5	

Paint System #13

Coat #	*Lining Applied*	*Bach No.*		*Color*	*Thinner No.*	*Average DFT Obtained*	*DFT Min.*	*DFT Max.*
1st	PPG Amerlock 600	Part A	9610977658	White	#90-58	9.0	5.0	10.0
		Part B	9538919959					
2nd	PPG Pitthane ultra	Part A	00338143	Package White	#21-85	13.5	2.0 (7.0)	3.0 (13.0)
		Part B	00338156					
Method of Application: Conventional Air		**DFT & Profile Readings:** SSPC PA-2 Level 3			**Total:**	13.5	7.0	13.0

DFT Gage Type: Electronic Mil Gage	**Model:** Posit Tector 6000 FN	**ID Number:** 326917	**Calibrated:** 9/23/2025	**Due:** 9/23/2026	**Certificate Number:** 86633

Blast Conditions

	Humidity	Ambient	Surface	Dew Point	Surface (-) Dew Point	Time	Date	Weather
Blast	65%	89°F	87°F	51°F	36°F	10:00AM	7/30/2026	Clear

Abrasive Type: Garnett	**Type of Blast:** SP- 10	**Grade:** 30/60

Condition of Surface Prior to Blasting: Mil Scale	**Removal of Contamination Prior to Blasting:** SSPC-SP1	**Chloride Test:** ACCEPTED s

AP Gage Type: Press-O-Film Gage	**Model:** 2804S-10	**ID Number:** LXQ577	**Calibrated:** 1/7/2026	**Due:** 1/7/2027	**Certificate Number:** 8991

Painting Conditions

Coat #	Readings	Humidity	Ambient Temp.	Surface Temp.	Dew Point	Surface (-) Dew Point	Time	Date	Interval Hours
1st Coat	Started Paint.	61%	93°F	88°F	57°F	31°F	2:00PM	7/30/2026	
2nd Coat	Started Paint.	55%	89°F	85°F	59°F	26°F	7:00AM	7/31/2026	


Temp Gage Type: Electronic	**Model:** Posi Test DPM	**ID Number:** 213359	**Calibrated:** 1/7/2026	**Due:** 1/7/2027	**Certificate Number:** 26-956937

P&P Representative — Date: 8/1/2026

Customer Representative — Date

P&P Industrial Coatings

Tel: 918-895-6030 3251 N. Osage Dr. Tulsa, OK 74127 Fax: 918-895-6031

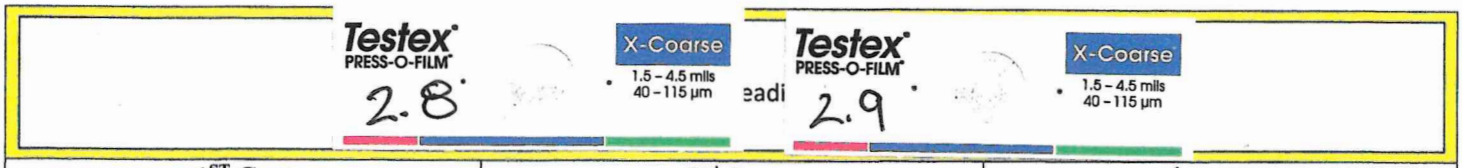

	1ST Coat					2nd Coat					3rd Coat N/A				
	1	2	3	Average		1	2	3	Average		1	2	3	Average
Set 1	7.6	9.1	9.1	8.6	Set 1	11.2	16.4	15.4	14.3	Set 1				
Set 2	10.4	8.4	7.8	8.8	Set 2	13.6	17.8	14.9	14.3	Set 2				
Set 3	12.9	8.3	8.2	9.8	Set 3	10.5	15.1	14.2	13.2	Set 3				
Set 4	12.7	8.7	10.3	10.5	Set 4	11.1	13.2	14.2	13.0	Set 4				
Set 5	11.7	7.7	11.7	10.3	Set 5	10.5	11.2	14.9	12.7	Set 5				

SSPC-PA2 Level 3

P&P Industrial Coatings

el: 918-895-6030 3251 N. Osage Dr. Tulsa, OK 74127 Fax: 918-895-6031

Coatings Application Inspection Checklist

THE INSPECTOR SHALL VERIFY THAT THE FOLLOWING ITEMS ARE IN ACCORDANCE WITH THE SPECIFICATION AND DRAWING REQUIREMENTS AT THE TIME OF THE INSPECTION.

No.	Description	Accept	Reject	Comments
1	**Pre-Coating Inspection**			
1.1	Verify that coating, thinning, and blasting materials are as specified.	X		
1.2	Verify that storage conditions for all materials are adequate and properly maintained.	X		
1.3	Verify that surfaces not to be coated are masked off or otherwise protected prior to surface preparation and coating application to adjacent surfaces.	X		
2	**Pre-Surface Preparation**			
2.1	Verify that oil and grease are removed prior to surface preparation.	X		Black light Test
2.2	Verify that welds and sharp edges have been suitable prepared.	X		
3	**Surface Preparation**			
3.1	Verify that the air supply is clean and free of oil and moisture.	X		
3.2	Verify the cleanliness and dryness of abrasives.	X		ASTM D4940
3.3	Verify the adequacy of cleaning and blasting equipment, hoses, etc.	X		
3.4	Verify the ambient, substrate, and dew point temperatures are appropriate.	X		Environmental ISO 8502-4
3.5	Verify that no contamination, salts & chlorides are present.	X		ISO 8502-6 Soluble Salts
3.6	Verify anchor profile.	X		SSPC VIS 1 or ISO 8501
4	**Coating Application:**			
4.1	Verify the materials are as specified, properly labeled, and shelf life is not expired.	X		
4.2	Verify the mixing, thinning, and induction times are per the specifications.	X		
4.3	Verify that the proper application equipment is being used.	X		
4.4	Verify that the air supply is clean and free from oil and moisture.	X		Blotter Test ASTM D 4285
4.5	Verify that the ambient, substrate, and dew point temperatures are appropriate.	X		Dust Test ISO 8502-3
4.6	Verify that the wet film thickness is being checked during application.	X		Environmental ISO 8502-4
4.7	Verify that recoat times are in accordance with the specifications.	X		
4.8	Visually inspect coatings for defects and uniform appearance.	X		
4.9	Verify dry film thickness of individual passes.	X		
4.10	Verify daily coating records are being maintained.	X		SSPC-PA 2, Level 3
5	**Final Acceptance**			
5.1	Visually inspect the final surface for color, defects, and uniform appearance.	X		
5.2	Verify dry film thickness.	X		
5.3	Verify that any identified repairs were made and are acceptable.	X		
5.4	Verify the coating system has cured prior to handling.	X		
5.5	Verify all daily coating records are complete.	X		

Coating Material

